

A form for an SSC Service Bulletin. It has a large, stylized arrow graphic that starts at the top right, goes left, then down, then right, and finally up to the bottom left, forming a loop. Inside the loop, the text "SSC Service Bulletin" is at the top. Below it is "no. 82-264". At the top right of the loop, there is a "DATE" field with "7/21/82" written in it.

TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES & SERVICE CENTERS
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODEL AFFECTED: MA-355

SYMPTOM: SCANNER CONTINUES TO SCAN OR JUMPS THE CHANNEL WHEN
TRANSMITTER IS KEYED.

CURE:

Add 150pF capacitor, 1523-0151-002, from the base of Q1601 to
ground. Designate this cap as C1603.

TECHNICAL SERVICE DEPARTMENT
REGENCY COMMUNICATIONS, INC.

